Thank you for choosing Products of LSIS.

Please follow the guideline carefully for proper and safe use.

## Check before installation


- 1. Please check if the product is the one that you ordered.
- 2. Please check if there is any damage or parts shortage.


# Specificatins

Type	Length	Code
UM-4R	400mm	84581831001
UM-5R	500mm	84581831002
UM-6R	600mm	84581831003

# Installation


- 1. Insert the protruded part (\*1) of Supporter to the edge and the hole in a TOR.
- 2. Separate the Nut(\*3) and Head Cap(\*4) from a Reset Bar, Insert the Reset Bar into a hole in a panel and then fix the separated Nut(\*3) and Head Cap(\*4) to the Reset Bar.
- 3. When you want to detach the attach supporter from a TOR, lift up the part \*2 and unlatch it from TOR.

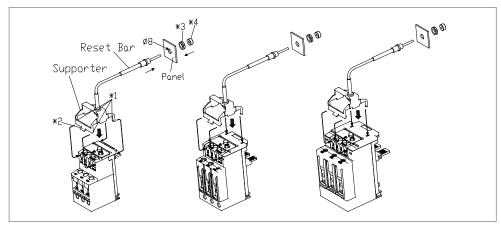

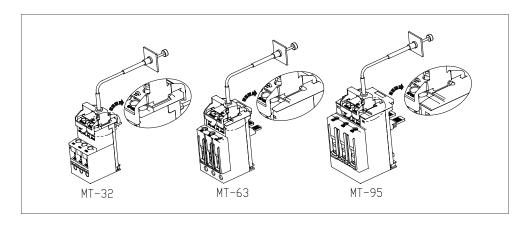

## Cautions

- 1. Please make sure that the lead wire do not bend within 55 from a panel and 35mm from a attach supporter.
- 2. Please make sure the semidiameter of a lead wire exceed 15mm.

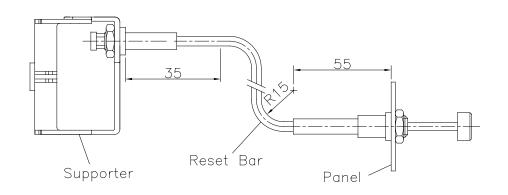

#### ■ HEAD OFFICE

Yonseijaedan Severance Bldg. 84-11, 5-ka, Namdaemun-ro, Chung-Ku, Seoul, 100-753, Korea
Tel. 82 - 2 - 2034 - 4870 Fax. 82 - 2 - 2034 - 4713

